

Care Instructions

Reflexite® Radiance & Performance Series



For heat applied/transfer garments application – High visibility workwear, leisure garments and accessories
Bulletin #CARE-10

GENERAL INFORMATION


Reflexite® Radiance and Performance tapes are microprismatic retro-reflective tapes, used to reflectorize garments.

Reflexite® Radiance and Performance clean as well at lower temperature as it does at higher temperatures. Therefore select the lowest washing temperature that will ensure adequate cleaning of the fabric. This will allow environmentally friendly washing and will exceed the life of the garment.

It may be necessary to modify the care label of garments with **Reflexite® Radiance and Performance** applied to ensure that the performance of the reflective tape is not compromised through improper care. We cannot guarantee that the trim, fused to a garment will survive a specific number of wash cycles. The wash performance will depend on chemical surface treatments on the fabric, application methods, as well as variability in the fabric manufacturing process.

Reflexite® Radiance and Performance, when washed in accordance with the care instructions provided, will typically withstand 25 washings when fused to 100% cotton T-shirt material. However, **Reflexite cannot guarantee performance** due to the variability in chemical treatments used on fabrics, fabric production, and application methods

RECOMMENDED CARE SYMBOLS

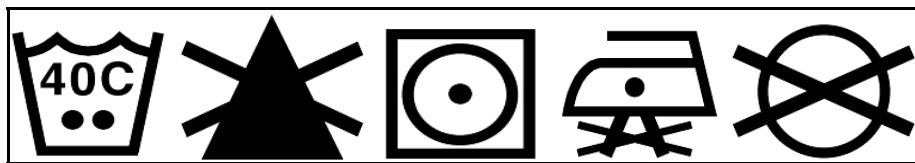

HAND WASHING

Hand washing can be done with a sponge, a soft fabric cloth or a soft brush with lukewarm water and a mild detergent. After washing the tape must be rinsed with clean water.

Stubborn stains such as grease or tar may be spot cleaned with petrol, alcohol, naphtha or turpentine. After spot cleaning the tape must be hand washed as above and rinsed with water.

HOUSEHOLD WASHING

Washer	Standard household washing machine Temperature 30° to 40° C
Detergent	Standard household detergent Household detergent. Use detergents with moderate pH levels. Avoid using detergents with high pH levels.
Setting	“Coloured clothing without pre-wash”

Maximum washing time on highest temperature not to exceed 12 minutes.
Maximum total washing time not to exceed 50 minutes.

BLEACHING

Do not use bleach.

Care Instructions

Reflexite® Radiance & Performance Series



For heat applied/transfer garments application – High visibility workwear, leisure garments and accessories
Bulletin #CARE-10

DRYING

Household tumble dryer, Normal, low heat.
Dry to "slightly humid". DO NOT OVER DRY.
Maximum exhaust temperature shall not exceed 65° C.
For extended life, garment should be turned inside out before drying.

CHEMICAL CLEANING / DRY CLEANING

Dry cleaning is not recommended.

IRONING

Do not use steam.
Use a cool or warm temperature setting.
Avoid direct contact of the tape when ironing, use a press cloth.

IMPORTANT NOTICE

All Reflexite products are subject to careful quality control throughout the manufacturing process and are warranted to be of merchantable quality and free from manufacturing defects.
Published information concerning Reflexite products is based upon research which the Company believes to be reliable although such information does not constitute a warranty.
Because of the variety of uses of Reflexite products and the continuing development of new applications, the purchaser should carefully consider the suitability and performance of the product for each intended use, and the purchaser shall assume all risks regarding such use.
All specifications are subject to change without prior notice.

Reflexite European Conversion Center

Cork Road
Unit 4, Industrial Estate
Waterford
Ireland
Tel. +353 51358132 / Fax: +353 51358258
www.reflexite-europe.com

Reflexite ® is a registered trademark of Reflexite Corporation, Avon CT, USA

Technical Publication EU-CARE-10, Pub. 2 March 2006
© 2006, Reflexite Europe